MANUAL

Classic Q6

4 Quadrant Circular Current

Thyristor Drive



Hans-Paul-Kaysser-Strasse 1 D-71397 Leutenbach 3 - Nellmersbach

Tel.: 07195/9283-0 Fax 07195/928329 email info@unitek-online.de Http://www.unitek-online.de

Con	itents	Page
1.	Basic Information	
	Safety advice	3
	Standards and guidelines	3
	General information	4
	Features	5
	Technical data	6
	Specification	7
	Interface	7
2.	Mechanical installation	
	Dimensions	8
3.	Electrical installation	
	Connections	9
	CE advice	11
	Auxiliary voltage connection	12
	Transformer power connection	13
	Motor connection	14
	Field option	15
	Actual value connection	16
4.	Adjustments	
	Current control loop	17
	LED displays	18
5.	Commissioning	19, 20
6.	Guarantee	21
7.	Protocol	22, 23
8.	Drawings	
	Dimensions Q6 (15A-25A)	25
	Dimensions Q6 (40-60A)	26
	Connections (Q6-A015)	27
	Circuit diagram (O6-S076)	28

Electronic Equipment is not fault proof. This fact should be borne in mind for all possible operating conditions.

ATTENTION - High Voltage

AC 250/440V~, DC 180/300V=



Before installation or commissioning begins, this manual must be thoroughly read and understood by the technical staff involved.

If any uncertainty arises, the Manufacturer or Dealer should be contacted.

Classic Q6 devices are Power Electric parts used for regulating energy flow. Protection rating IP00.

Standards and Guidelines:

The device and it's associated components can only be installed and switched on where the local laws and technical standards have been strictly adhered to:

EU-Guidelines 89/392/EWG, 84/528/EWG, 86/663/EWG, 72/23/EWG

EN60204, EN50178, EN60439-1, EN60146, EN61800-3

- IEC/UL IEC364, IEC 664, UL508C, UL840

- VDE-regulations VDE100, VDE110, VDE160

- TÜV-regulations

- Regulations of Professional and Occupational bodies: VGB4

The user must ensure that in the event of:

- device failure
- incorrect operation
- loss of regulation or control

the axis will be safely de-activated.

It must also be ensured that the machine or equipment be fitted with device independent monitoring and safety features.

Setting Adjustments

- should only be carried out by suitably trained personnel
- should only be carried out in accordance with Health and Safety guidelines

Installation

- should only be carried out when all Voltages have been removed.

QS Test results are archived with the device serial number by the manufacturer.

CE The device adheres to the following: Guideline EU 89/336/EWG. EMV standards EN61000-2 and EN61000-4.

Attention:

This device description MANUAL Q6 refers to the power section, and must be read in conjunction with the regulation (REG) description. The following regulation sections for 4 quadrant control are available:



Analog Regulation REGx.

General

In conjunction with a regulation board (for example REGx) the Classic Q6 range of thyristor Drives act as Current controllers. (Moment of inertia controllers).

A 26-pin connector, common to all boards, is used to connect the power and regulation boards.

Using this interface it is possible for any external control arrangement including third party equipment to drive the power section.

Q6 Drives are used to control the speed, voltage or moment of inertia of dc motors in current circulating 4 quadrant mode.

Moment of inertia is applied continuously to the motor without interruption.

Build

- switch cabinet mounting according to the VDE, DIN and EU regulations
- standard control electronics REG
- intrinsically safe power section with current control loop
- optional units

Galvanic isolation between

- the power section and the housing
- the power section and the control electronics

The distance of air gaps and leakage paths adhere to the VDE standards (>8mm).

Components

- fully insulated thyristor modules, comfortably over-dimensioned
- only components customary in trade and industrially standardised are used
- LED displays
- DIP switches for the P-I adjustment of the current control loop
- precision potentiometers for fine adjustments
- DIP switches for the system set-up

Characteristics

4.	•		
*	Series	Classic O6	

- * Thyristor drive for dc motors
- * Power range 2.7kW to 15kW
- * 4-quadrant control
- * Energy recovery
- * intrinsically safe power section
- * Fast analogue current control
- * 26-pin interface
- * Features of the control electronics:
 - see Manual REGx or third-party product documentation

Optional units

Q6 160/180-x						
Power connection	6x 140	6x 140 180V~				
Auxiliary voltage conn.	360 4	140V~ od. 200	250V~			
Output Voltage	max. ±	180V=				
Cooling	self coo	ling				
Drive Q6 160/180-		15 25 40 60				
Input current phase	A~	6.12	10.2	16.32	24.48	
Output current Peak	A=	30	50	80	120	
Contin.	A=	15	25	40	60	
El. power	kW	2.7	4.5	7.2	10.8	
Input fuses (fast acting)	А	10	16	35	50	
Mains transformer (UID std.)	Туре	150 A	180 B	180 C	210 C	
Circulating current chokes	Туре	EI 120A-16	EI 120A-24	EI 135B-40	EI 170B-60	
	mH	10	8	3,1	3	
Dimensions WxHxD Weight	mm kg	102x102x130 4.3		115x130x145 8.2	140x162x200 12.5	

Q6 230/250-x						
Power connection	6x 180 .	6x 180 260V~				
Auxiliary voltage conn.	360 4	40V~ od. 200	250V~			
Output voltage	max. ±2	250V=				
Cooling	self coo	ling				
Drive Q6 230/250-		15	25	40	60	
Input current phase	A~	6,12	10,2	16,32	24,48	
Output current Peak	A=	30	50	80	120	
Contin.	A=	15	25	50	60	
El. power	kW	3,75	6,25	12,5	15	
Input fuses (fast blow)	А	10	16	35	50	
Mains transformer (UID std.)	Туре	150 A	180 B	180 C	210 C	
Circulating current chokes	Туре	EI 120A-16	EI 120A-24	EI 150B-40	EI 170B-60	
	mH	18	8	6	3	
Dimensions WxHxD Weight	mm kg	102x102x130 4.3		128x132x185 10.6	140x162x200 12.5	

Specification

Mains frequency 50 or 60Hz ±5% Protection rating IP 00

Format VDE 0100 group C, VDE 0160

Humidity rating class F acc. to DIN 40040 Site of installation < 1000m above sea level

Operating temperature range 0 ... 45°C

Extended operating temp. range up to 60°C reduced by

2%/°C

Storage temperature range -30°C to +80°C

Amplification

- input signal 0 to ±10V=

- output 0 to ±200% type current

Enable +10V

Current control loop circuit

- control precision ±2%

- control range 1:50

Speed control loop circuit with REG

- control precision (without actual value error) ±0.1%


- control range 1:1000


Interface control electronics X3

Function Connector no.

+ 24V	±10%		X3: 1 and 2
+ 15V	± 2 %		X3: 3 and 4
- 24V		±10%	X3: 5 and 6
- 15V		±2%	X3: 7 and 8
Device GND	0		X3: 9, 10, 11, 12, 13, 14
I command value (GND)	0		X3: 15
I command value (signal)	±10V=		X3: 16
Current controller enable	+10V =		X3: 17
Drive disable1	+10V =		X3: 18
Drive disable 2	+10V =		X3: 19
N (speed) actual	+10V =		X3: 20
l (current) actual	+10V =		X3: 21
Over-current power section	n/a		X3: 22
Trigger angle1	+10V =		X3: 23
Trigger angle 2	+10V =		X3: 24
Drive ready BTB	+10V =		X3: 25
Free	n/a		X3: 26

Classic Q6 X/X

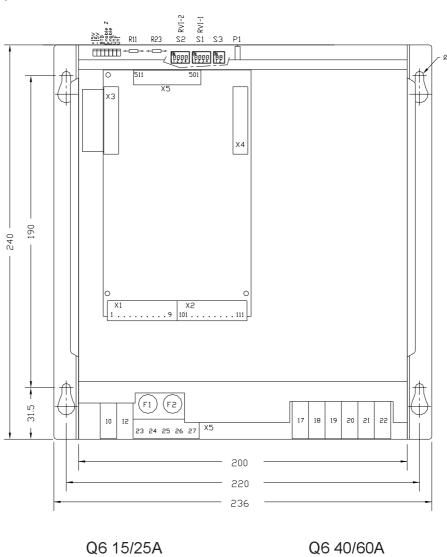

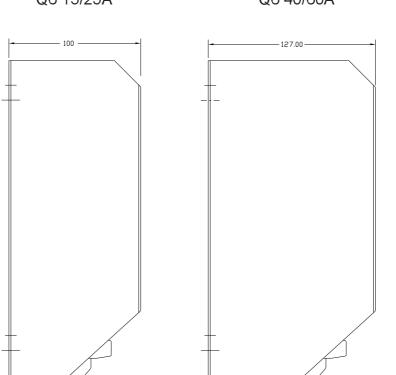

Attention:

The order of the connections to the connector numbers or screw terminals is obligatory. All further advice is non-obligatory.

The input and output conductors may be altered or supplemented in accordance with the electrical standards.

Note:

- Connection and operating instructions
- Local regulations
- EU guideline 89/392/EWG, 84/528/EWG, 86/663/EWG
- VDE and TÜV regulations and Trade body guidelines
- CE and EMC advice



Connection

Connecting Conductors					
Continuous Current A 15 25 40 60					60
Power connection cross section, minimum	mm²	1.5	1.5	2.5	4
Motor connection cross section, minimum	mm²	1.5	1.5	4	10
Control voltage connection cross section, minimum	mm²	0.5	0.5	0.5	0.5

The devices adhere to the EU guidelines 89/336/EWG and the technical standards EN 61000-2 and 61000-4 provided that the following conditions are observed:

- The device, the transformer, and filter capacitors are mounted on a 500x500x2 mm mounting plate.
- The mounting plate must be connected to ground using a 10mm² wire.
- The motor housing must be connected to ground using a 10mm² wire.
- The device ground X1:8 must be connected to the mounting plate using a 2.5mm² wire.
- Device PE screw must be connected to the mounting plate using a 4mm² wire, l = 50mm.

Three-phase connection:

Transformer type: see technical details $3x1\mu F(x) + 0.5x1\mu F(y)$


Conductor length between the device and the power choke <250mm

Motor connection:

Motor conductors I = 1.5m, shielded

Tacho and all control lines I = 1.5m, shielded

Shielding connected to PE

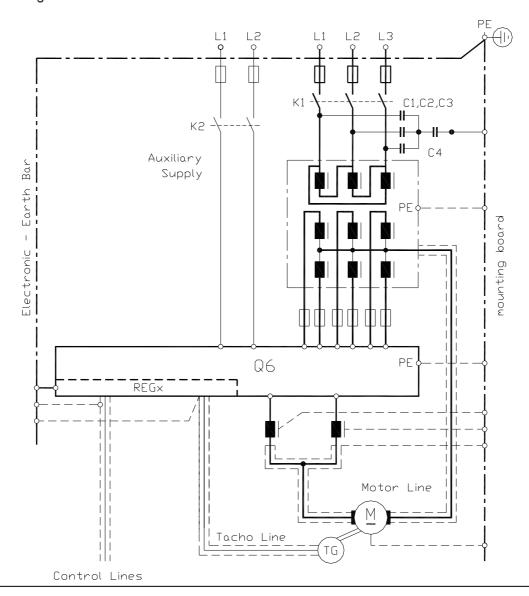

The connection advice is a general information and it is non-obligatory.

Adhere to:

- connection and operating instructions
- local regulations
- EU guideline 89/392/EWG
- VDE and TÜV regulations and Trade body guidelines

Switch on the auxiliary voltage and the supply voltage simultaneously. **Switch off** the supply voltage after the auxiliary voltage.



Input filter

see CE advice, page 11 Short conductor length to be used between the input filter and the device

Auxiliary voltage connection

Connection terminal X5:23, X5:24

Power supply 230V~ or 400V~ (observe the type plate)

Input current 0.1A'
Phase position regardless
Internal fuses 0.8AT


60Hz mains supply

In order to operate the thyristor drive via a 60Hz mains supply, the contacts 1 and 2 of the switch S3 must be in position ON.



Transformer power connection

A special Q6 transformer is used. The primary side uses a Delta connection, the secondary side is arranged as a 6-phase centre-tap circuit.

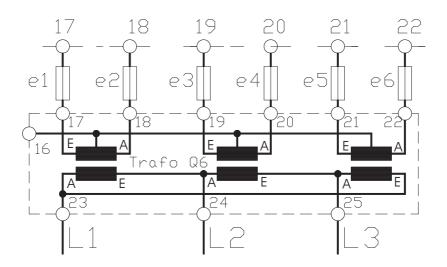

L1, L2, L3 - clockwise rotating field

A= beginning of the winding

E= winding end

Transformer rating

PTr = secondary voltage x continuous current (I) x 1.4

To allow for the dc current loading, the transformer must be over-dimensioned by a factor 1.4.

Transformer fuse

Slow acting

Input fuses

Super fast acting (e1... e6)

These fuses are internally monitored for drop out.



Attention:

If the secondary voltages produced by the transformer are inferior to those specified in the technical data, please indicate these voltages on order, as 6 internal resistors must then be adapted.

Motor connection


Connection

Motor - terminal X5:10

Motor + terminal X5:12

Motor terminal 16

(across the transformer)

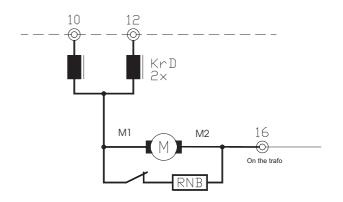

Armature choke

Inductance L [mH]=(UA/IA)x0.8

When the command value is positive, M1 is positive and M2 (16) is negative.

Switching in the armature circuit

- dc circuit current-free
- disable inactive



Warning:

Switching off under current will create arcing across the switch contacts.

Switching on while the drive is enabled will cause the fuse to fail.

Power supply failure - brake resistors

Break contact of the mains contactor K1

The resistors are to be connected in parallel directly to the motor armature without isolating the motor from the control unit.

Attention:

The power lines are to be shielded and routed separately from control lines!

For electro-magnetic interferences please refer to the advice, page 11.



Field connection (option)


Connection

Terminal connector

Input X5:23, X5:25

Field negative X5:27 Field positive X5:26

Field voltage



Power supply 230V~ 210V= 400V~ 360V= 400V~ with N 210V=

Field current max. 1.5A

Fuses 2.5Af

Watchdog if the fuse fails, the device switches off

Actual value Connection

Tacho

Feedback device options

- dc- Tacho generator (standard)
- ac- Tacho generator with shaft angle detection (optional extra)
- incremental encoder with direction dependant (optional extra)

Connection


Regulation section (see the REG manual)

In the case of a positive command value

• Tacho plus X 1:8b


Tacho minus X 1:9

• Shield X 1:8

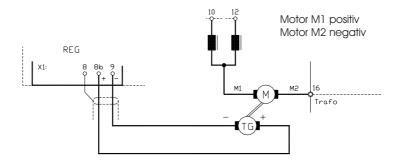

Armature Voltage

The armature Voltage may be used as the actual value. In this case the control resolution will be greatly reduced (1:50).

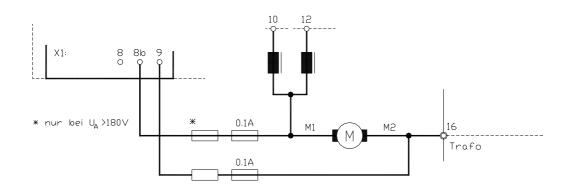

Limiting the actual value voltage

- Fusing 2x 0.1A/500V directly in the armature circuit!


- For armature voltage >180V= additional resistors are required


4 Adjustments

Current controller

The PI characteristics of the controller are adjusted by means of DIP switches.

Switch		Controller
S 1	>>>	RVI-1
S2	>>>	RVI-2

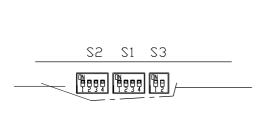

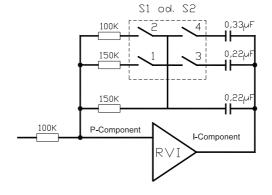

Circular current

The circular current is adjusted by means of P1. It is increased by turning the potentiometer anti-clockwise.

Measurement:

The circular current can be measured across the choke circuit when the motor is stationary.

Please observe:

The device circular current corresponds to the circular current plus motor current. Thus, the motor current is reduced if the adjusted circular current value is too high.



Optimization of the current controller

- Connect an oscilloscope across the current actual value
- Current command value step-change 1V
- Increase the current command value by 1V steps to 10V
- Alter the P-amplification by means of the DIP switches S2:1 and S1:1, S1:2 and S2:2
- Optimal adjustment see fig. 1
- Not permissible adjustment see fig. 2
- Alter the integral part by means of the DIP switches S2:3 and S1:3, S2:4 and S12:4

Oscilloscope - Current adjustment

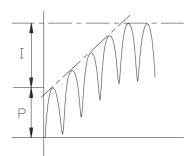


Fig. 1
Optimal adjustment


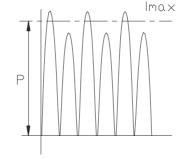


Fig. 2
P-amplification too high

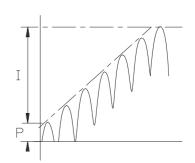

X3:21


X3:16

Fig.3
P-amplification too low

Displays

Some important functions are indicated by LEDs: green LEDs indicate the active state

Display	LED designation
ready for operation	ВТВ
Auxiliary voltage watchdog	+15V, -15V
Enable current controller	enable
Enable triggering	enable triggering
Current command value direction	RVI-1 or RVI-2



BTB signal - Drive ready

BTB signal X3:25 >+10V Error X3:25 <+2V

Errors:

- auxiliary voltage supply: +24V, +15V, -15V
- power supply connection: fuse failure, under-voltage

In case of errors or failure the power section is immediately internally disabled without delay.

Measurement advice

Measuring instruments: multimeters for current and voltage

Measuring faults: mean value > actual value

acc to the form factor

approx. 1 to 5%

Measured values

with a positive command value

Voltage: positive between the choke centre point (A) and the


transformer (16), max 1.15 x power supply

Current: ammeter in the motor circuit

Measured values REG

Speed X2:109 $\pm 5V$ or $\pm 10V$ for $\pm 100\%$ speed Current X2:111 $\pm 5V$ or $\pm 10V$ for $\pm 200\%$ current

GND X2:104

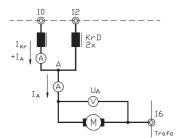

5 Commissioning

1. Connection advice

Connect the drive in accordance with the Q6 manual and the control electronics manual (e.g. REG).

Please observe in particular:

- Check the power supply voltage with that specified on the type plate.
- Insert the fuses according to the technical data (page 6).
- Check the field voltage connection and the motor and tacho connections!

2. Commissioning

Basic connections:

Mains supply, field, tacho, or armature feedback, drive enable, command value.

For armature voltage control the tacho watchdog must be switched off.

2.1 Drive enable switch open or drive enable voltage 0V

Command value 0V

Switch S9 adjust to tacho voltage

for armature voltage control adjust to 0
Switch S4 position 2
Switch S5 position 6

Potentiometer Imax1, Imax2 adjust to approx. 10% of full scale

Potentiometer XP adjust to 50% Potentiometer ID = 100%

Switch tacho control **ON**: DS1 K:1, DS2 K:3 and 4

OFF: DS3 K:4, DS4 K:2

Bridges R13 and R14 soldered-in

Switch armature voltage control **ON:** DS1 K:1, DS2 K:3 and 4, DS3 K:4,

DS4 K:2 and 4

Bridges R13 and R14 open!

2.2 Apply the voltage

The LEDs L3 (BTB) and L7 (stationary) must light.

All other LEDs are off.

2.3 Close the switch 'drive enable' or apply a drive enable voltage of 10V

The LEDs L1 and L2 must also light

The drive must be at a standstill or turn slowly (offset).

If the drive accelerates in the correct direction, the polarity of the tacho voltage and the armature voltage feedback must be changed.

If the drive accelerates in the wrong direction, the polarity of the armature or the field must be changed.

2.4 Increase the command value voltage to approx. 10%

The drive must accelerate to approx. 10% of the speed.

If the rotation direction is wrong, change the polarity of the tacho and

the field **or** the polarity of the tacho and the armature.

2.5 Current controller amplification

(Switch S1, S2 on the power section)

The current amplification is adjusted to a low armature circuit inductance (all switches "On")

High inductance values can lead to motor oscillation which cannot be influenced by means of the speed controller. In this case, first set switch S1-2 then switch S2-2 to "Off".

If the drive still does not run smoothly, set the switches S1-1 and S2-1 to "Off". The current response can be measured by means of an oscilloscope across the test point X4:20 (see page 17).

2.6 Speed controller amplification

Adjust on the REG board.

Adjust the P-term to the lowest possible setting from 1 to 5 (switch S4).

Adjust the I-term to match the axis momentum (switch S5):

large axis momentum

- high adjusted value

small axis momentum

- low adjusted value

With the command value set to 10% speed, increase the amplification by turning the potentiometer Xp clockwise. When the drive begins to oscillate, reduce the amplification by turning the potentiometer anti-clockwise by approximately 10%.

For the fine adjustment of the amplification the control response should be measured by means of an oscilloscope across the test point X4:15 (see page 17).

2.7 Further adjustments

such as speed, peak current, continuous current, etc. (rf. to the manual REG and Q6)

2.8 Switching Off

If the switch 'drive enable' is opened, or the drive enable voltage is switched to 0V, the LED L1 will extinguish and the drive will brake until standstill. After approx. 2s the LED L2 will extinguish and the drive is disabled. After approx. 5 more seconds, the thyristor triggering circuit is disabled.

2.9 Commissioning adjustments

The adjustments should be documented in the protocol and the adjustment potentiometers should be sealed with a suitable lacquer.

6 Guarentee

Guarantee

UNITEK guarantee that the Device is free from material and production defects. Test results are recorded and archived with the serial number.

The Guarantee Time begins from the time the device is shipped, and lasts two years. Unitek undertakes no guarantee for devices which have been modified for special applications.

Defects, defective goods.

During the warranty period, UNITEK will, at its option, either repair or replace products that prove to be defective, this includes guaranteed functional attributes. UNITEK specifically disclaims the implied warranties or merchantability and fitness for a particular purpose. For warranty service or repair, this product must be returned to a service facility designated by UNITEK.

For products returned to UNITEK for warranty service, the Buyer shall prepay shipping charges to UNITEK and UNITEK shall pay shipping charges to return the product to the Buyer.

However, the Buyer shall pay all shipping charges, duties, and taxes for products returned to UNITEK from another country.

The foregoing warranty shall not apply to defects resulting from:

- * improper or inadequate repairs effected by the Buyer or a third party,
- * non-observance of the manual which is included in all consignments,
- * non-observance of the electrical standards and regulations
- * improper maintenance
- * acts of nature

All further claims on transformation, diminution and replacement of any kind of damage, especially damage, which does not affect the UNITEK device, cannot be considered. Follow-on damage within the machine or system, which may arise due to malfunction or defect in the drive cannot be claimed.

This limitation does not affect the product liability laws as applied in the place of manufacture (i. e. Germany).

UNITEK reserves the right to change any information included in this MANUAL. All connection circuitry discribed is meant for general information purposes and is not mandatory.

The local legal regulations, and those of the Standards Authorities have to be adhered to. UNITEK does not assume any liability, expressively or inherently, for the information contained in this MANUAL, for the functioning of the device or its suitability for any specific application.

All rights are reserved.

Copying, modifying and translations lie outside UNITEK's liability and thus are not prohibited. UNITEK's products are not authorized for use as critical components in life support devices or systems without express written approval.

The onus is on the reader to verify that the information here is current.

Protocol	
-----------------	--

Customer				
	Serial No			
[V~]				
[V~)				
[V=]				
	[V~]			

Inputs

Enable	contact?	voltage [V=]
Command value	type	voltage [V =]
Command value, additional	type	voltage [V=]
Current command value Imax1	external	voltage [V=]
Current command value Imax2	external	voltage [V=]

Speed controller settings

Switches

Tacho adjustment	S9	Position
P -term	S4	Position
I -term	S 5	Position
D -term	S8	Position



Potentiometers

Speed	nmax		Ρ4	Posit	ion
Peak current	- 1	max1		P5	Position
Peak current		max2		P6	Position
Continuous current	I	D		P7	Position
Integrator		NT		P1	Position
Amplification)	X Ρ		Р3	Position
IxR compensation				P2	Position





DS switches

ON	no.					
OFF	no.					

7 Protocol

Current controller settings

Switches

Switches S1, S2 open (off)

closed (on)

Switch S3

	OFF (50Hz)	ON (60Hz)
K1:		
K2:		

Measured data

Armature voltage	max.	[V=]	
------------------	------	------	--

Armature current peak [A=]

Armature current continuous [A=]

DC tacho voltage max. [V=]

Tacho voltage max. [V=]

Acceleration X4: [V/ms]


Integrator X4: [V/ms]

Motor data Type plate data


Manufacturer

Type Serial number Serial number

Motor voltage [V=] Motor current [A=]

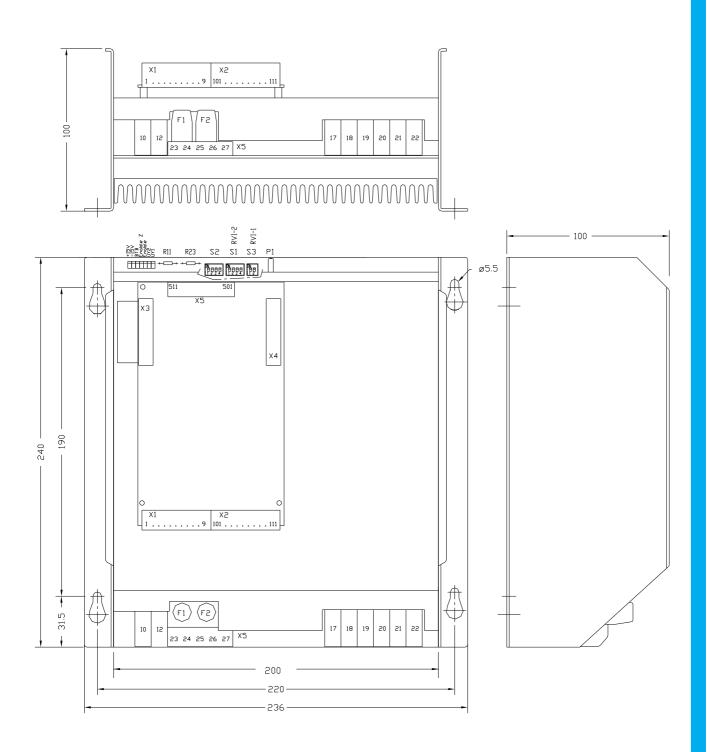

Q6-M012-15A

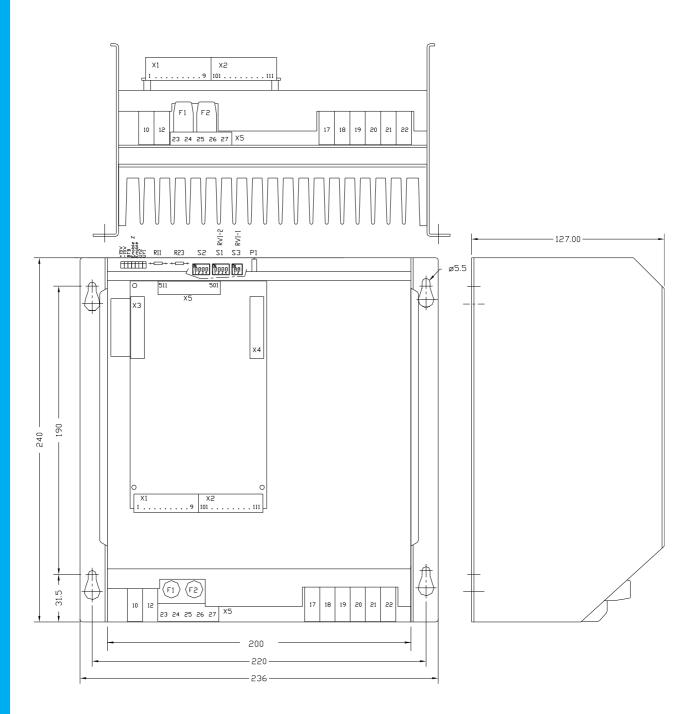

Q6-M012-40A

